

WakeNet USA October 20 & 21, 2010






Wake Vortex Reporting to ASRS

▶ 199 reports received to date

- 129 Structured Callbacks completed through Oct 1 2010
- 29 Structured Callbacks completed since last WakeNet Meeting (March 2010)

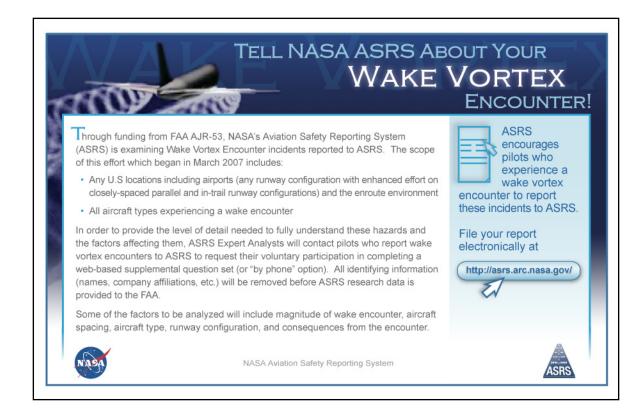






Descriptive Information

- 129 Unique Events August 2007 to Oct 1, 2010
 - 1 Supplemental Question Set completed for each event
- Majority Air Carrier Operations (n=95)
 - Remaining were Air Taxi, Corporate, FBO, Fractional, and Personal
- Majority were passenger operations (n=109) [see Figure]
- There were 11 events reported by pilots of single-crew aircraft, 114 by pilots of multi-crew aircraft

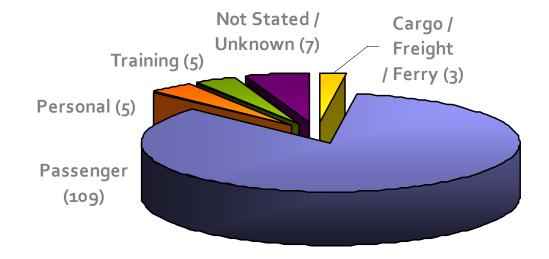





Flight Segment at Wake Encounter

Flight Segment


Wake Encounter Aircraft

- 88 in Terminal Area
 - 60 on Arrival; 28 on Departure
- 41 Enroute

Runway Change

Wake Encounter Aircraft
Terminal only

3 aircraft received a runway change prior to WVE and 85 did not

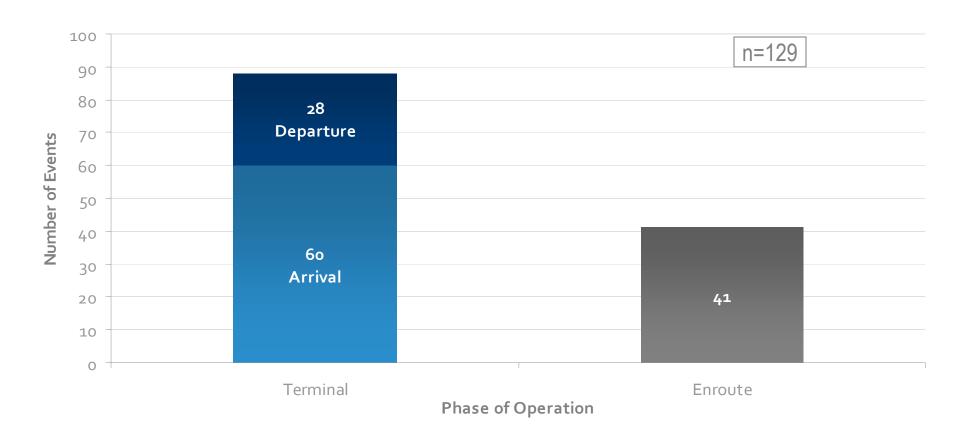

Terminal Operations

(88 in Terminal Area: 60 on Arrival & 28 on Departure)





Terminal Operations ARRIVAL (n=60)





Airport Information - Arrival

- Airport Identifier
 - LAX (n=11); ORD (n=6); ATL (n=4); SNA (n=4); SFO= (n=4);
 CLT (n=3); and others
- Distance from Runway
 - Within 5 miles (n=31); 7+ Miles (n=25); 10+ Miles (n=21)
- Wind Speed
 - Majority of the winds were calm (n=13) or light / below 10 knots (n=21).





Notable Reporter Comments

(A CRJ-701 behind an A320 at 3500 MSL on arrival to CLT)

Report Narrative: ...Being vectored on to the RWY 23 approach in CLT the approach controller put us on and cleared us for the approach 4.5 miles in trail of another a/c. She assigned us 160 kts till LECAR. She handed us over to the tower and that's when the event started, the aircraft started to roll right then left 40 degrees and it got worse for approx. a minute or two. Once we got the a/c under control I called the tower and asked what type of aircraft we were behind. I was told an A320. I informed him that we had been through severe wake turbulence. ... Someone is gonna get killed if something isn't done. I understand the idea of moving the traffic but this is not safe. Maybe the approach controllers should advise of the a/c type ahead and provide at least 5 mile in trail all the way to the runway.


Additional information from response to SQS C.15: This is <u>becoming more and more common it seems on departure as well as arrival in KCLT</u>. This event was the worst i have yet to experience. 4.5 miles in trail on the approach behind this airbus on a hot calm day was not sufficient space to stay out of the wake.

Additional information from response to SQS C.16: It seems that the A320-321 series a/c produce a lot of wake. There needs to be some criteria similar to the criteria behind B757's for these types of a/c. I am very much concerned that

someone will be hurt before criteria is established. –ACN 897674




Distance from Wake Producing Aircraft - Arrival

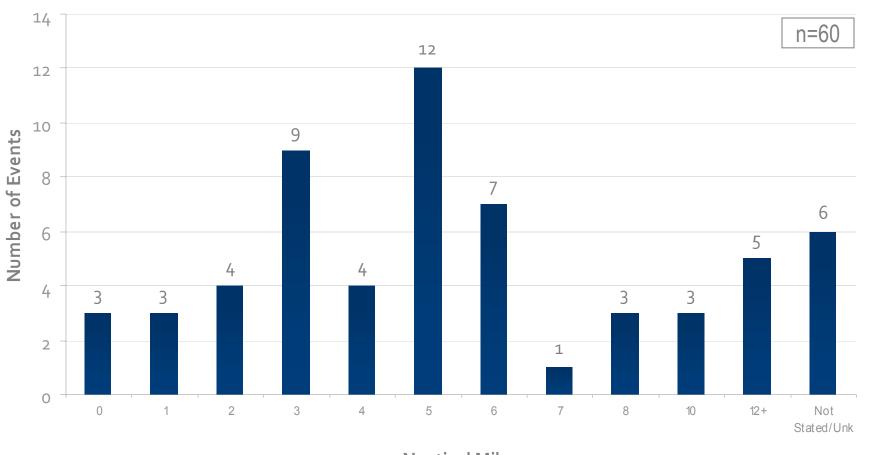





Altitude of Wake Encountering and Wake Producing Aircraft - Arrival

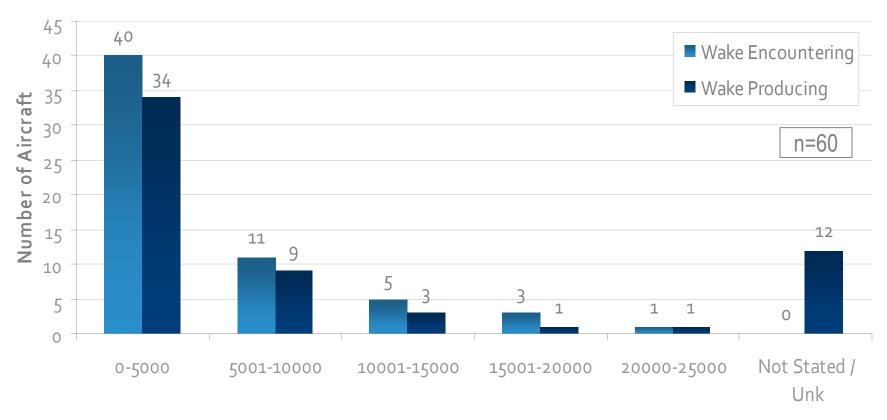


Altitude at Time of Encounter (MSL)





Altitude of Wake Encountering and Wake Producing Aircraft (0-5000 MSL) - Arrival

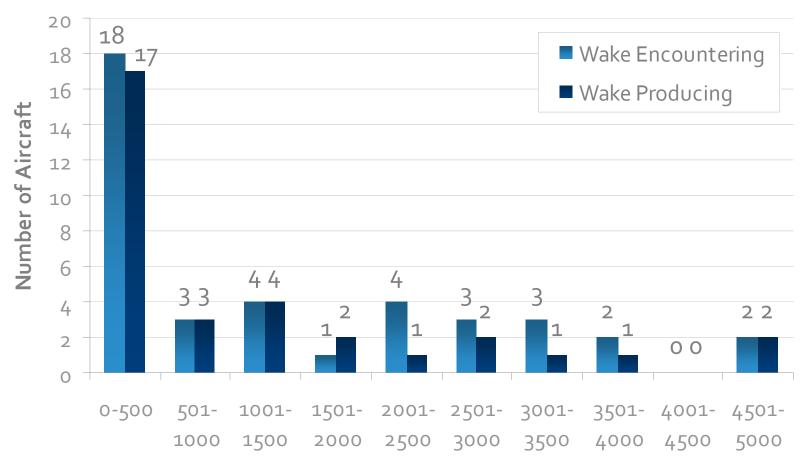


Altitude at Time of Encounter (MSL)





Distance from Runway - Arrival

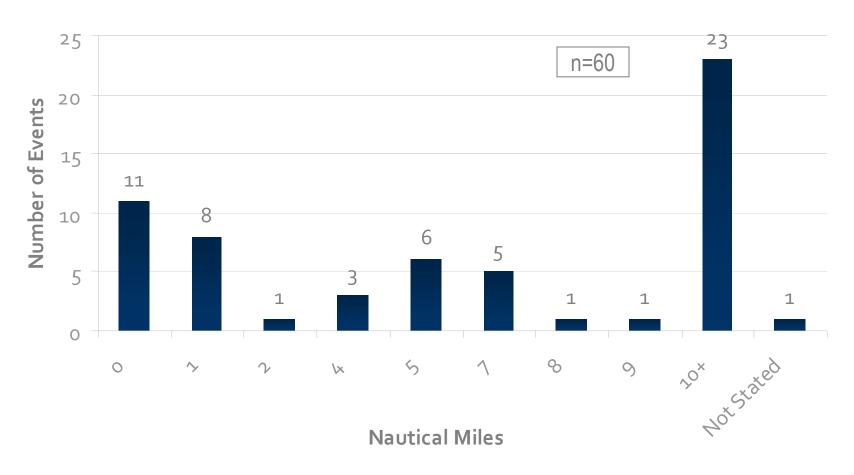





Encounters in Terminal Airspace - Arrival

n=60

		Wake Encountering Aircraft Weight Category					
		Heavy (H)	757	Large (L)	Small (S)	Unknown (U)	Total for Generating Category
Wake Producing Aircraft Weight Category	Н	4	1	23	1		29
	757			6	1		7
	L			14	4		18
	S				5		5
	U			1			1
Total for Encountering Category		4	1	44	11		60





Terminal Operations DEPARTURE (n=28)





Airport Information - Departure

Airport Identifier

PHL (n=4), DFW (n=3), LAS (n=4), SNA (n=2), ORD (n=2), ATL (n=2) and others


Wind Speed

 The majority of the winds (n=9) were under ten knots, light and variable, or calm; however, four pilots reported winds between 15 to 20 knots.






Distance from Wake Producing Aircraft - Departure

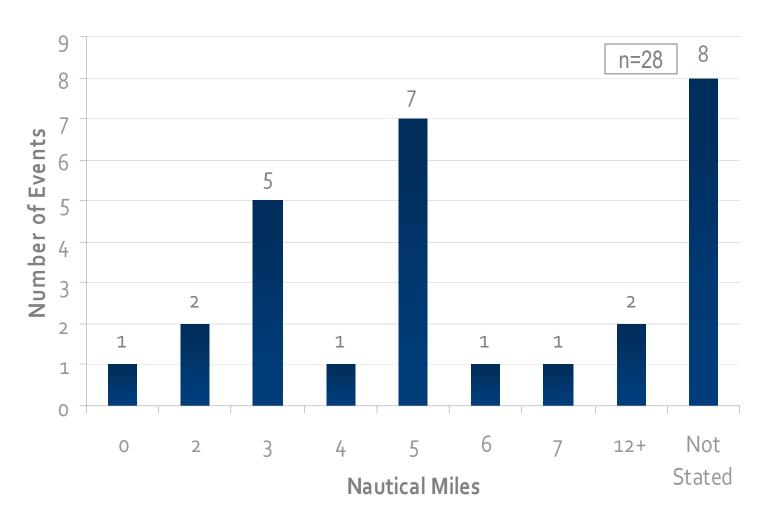





Altitude of Wake Encountering and Wake Producing Aircraft - Departure

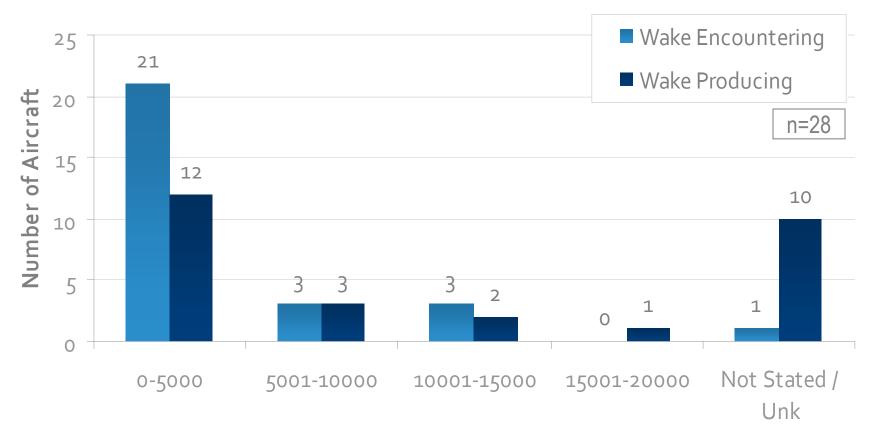


Altitude at Time of Encounter (MSL)





Altitude of Wake Encountering and Wake Producing Aircraft (0-5000 MSL)- Departure

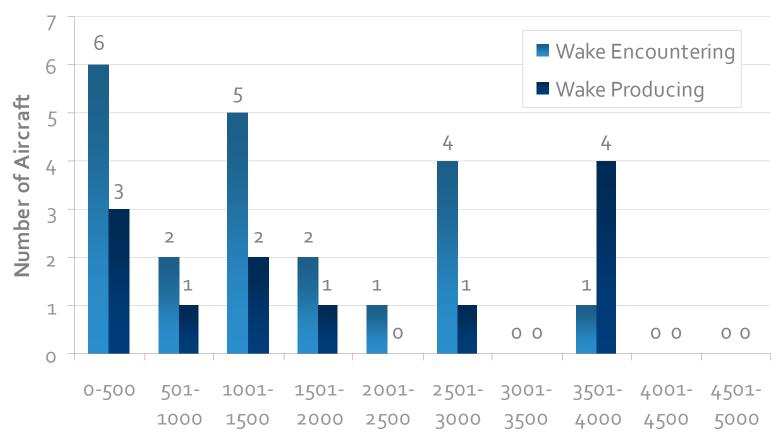

Altitude at Time of Encounter (MSL)





Encounters in Terminal Airspace - Departure

n=28

		Wake Encountering Aircraft Weight Category					
		Heavy (H)	757	Large (L)	Small (S)	Unknown (U)	Total for Generating Category
Wake Producing Aircraft Weight Category	Н			3			3
	757	1		3	1		5
	L			13	3		16
	S				1		1
	U			3			3
Total for Encountering Category		1		22	5		28






Enroute Operations

(n=41)





Distance from Wake Producing Aircraft - Enroute

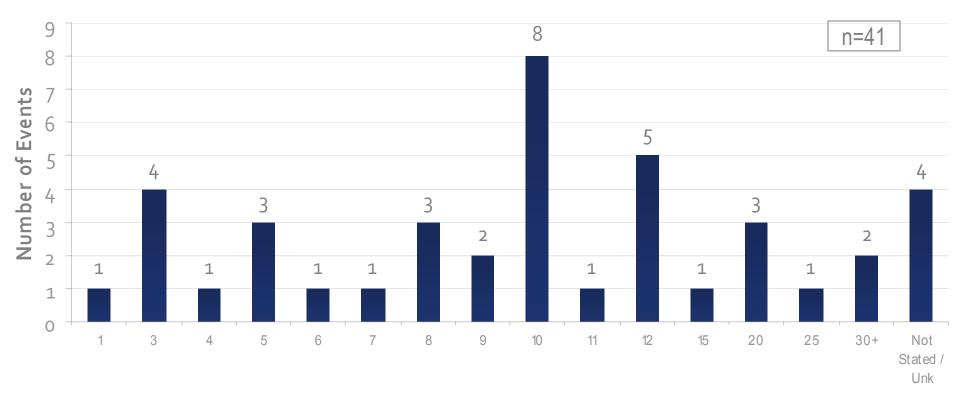

Nautical Miles



Oct 1, 2010



Distance from Wake Producing Aircraft - Enroute

[Global Express 15 miles behind an A320 encountered wake at FL240 and 16,000 feet]

As a result of this experience, I usually make a practice of leveling 100 FT high when in this situation, especially if the winds aloft are less than 10-15 KTS. Based on conditions during these encounters, I am extra vigilant to the likelihood of an wake encounter whenever the winds are a quartering tail as I perceive the wake may be being "held up" by the atmospheric conditions. - ACN 848630


[CRJ-200 10 miles behind and 500 feet below a B767 at FL310]

behind a heavy aircraft in a light quartering tailwind. This highlights the importance of the wake turbulence research which is being done. In the future, i will pay attention to airplanes much further ahead. –ACN 759718





Direction of Wake Producing Aircraft - Enroute

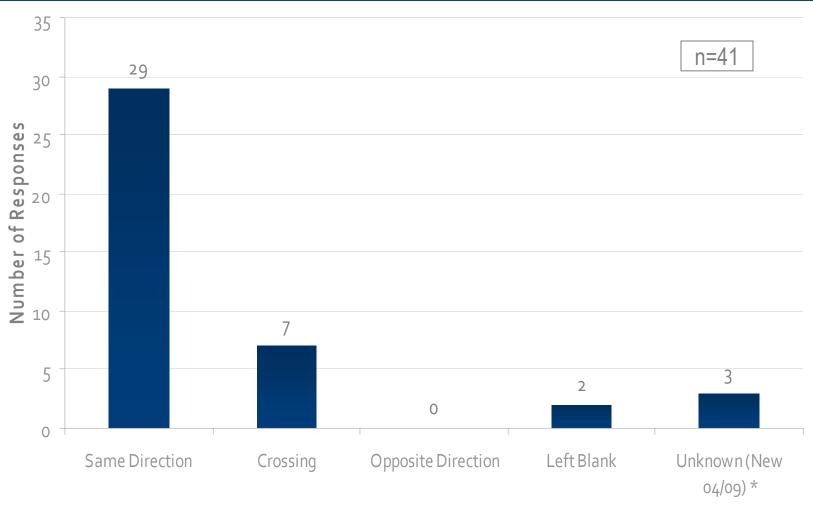








Altitude of Wake Encountering and Wake Producing Aircraft - Enroute

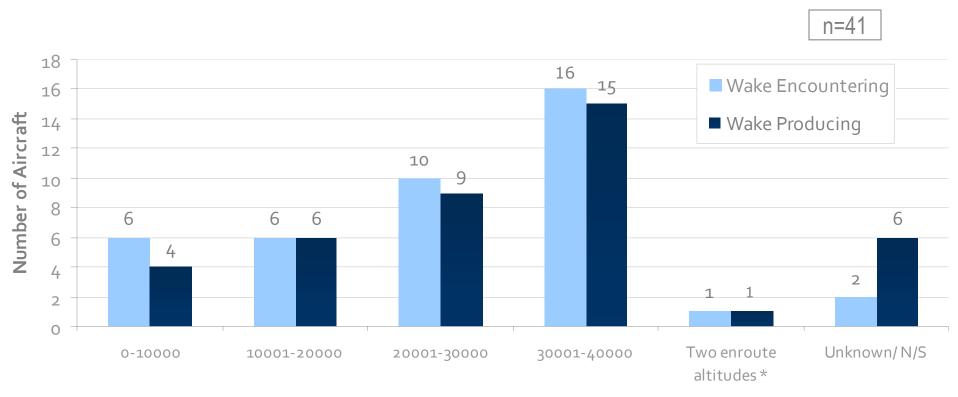


Altitude at Time of Encounter (MSL)



*1 aircraft encountered wake at 2 altitudes-- 10,500 MSL and 25,500 feet MSL (aircraft producing wake was 4,000 feet higher for each encounter)



Flight Phase of Wake Producing and Wake Encountering Aircraft - Enroute

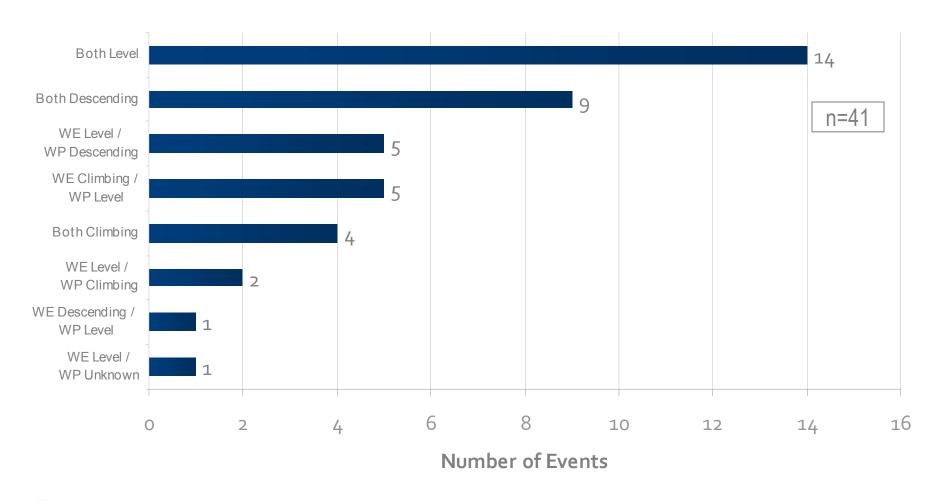





Encounters in En Route Airspace - Enroute

n = 41

		Wake Encountering Aircraft Weight Category					
		Heavy (H)	757	Large (L)	Small (S)	Unknown (U)	Total for Generating Category
Wake Producing Aircraft Weight Category	Н	2	1	10			13
	757			3	2		5
	L		2	5	5		12
	S	1			1		2
	U	4	1	4			9
Total for Encountering Category		7	4	22	8		41






Effects and Consequences of Wake Encounters

(n=129)






Pilot Assessment of the Magnitude of Wake Encounter

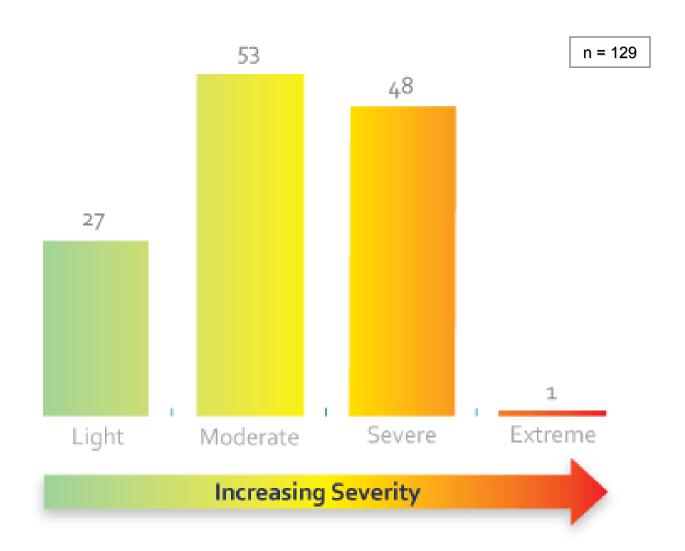





Effects on Aircraft

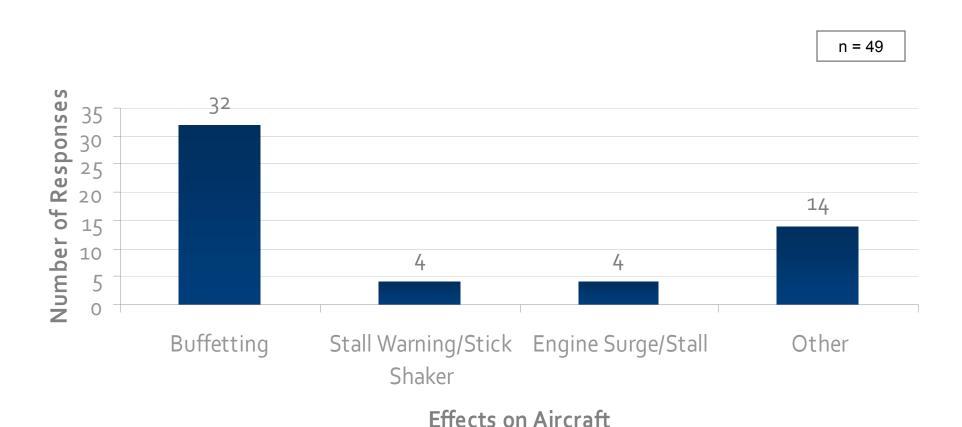






Heading, Pitch, Roll and Yaw Changes

- ▶ 1 event categorized as EXTREME
- 49 events categorized as SEVERE
 - Single event maximums
 - Maximum reported heading change of 80°
 - Maximum reported pitch change of 45-50°
 - Maximum reported roll change of 110°
 - Maximum reported yaw change of 30°
- 53 events categorized as MODERATE
- 27 events categorized as LIGHT
- Max reported altitude loss was 1200 ft
- Max reported altitude gain was 500 ft





Effect on Autopilot

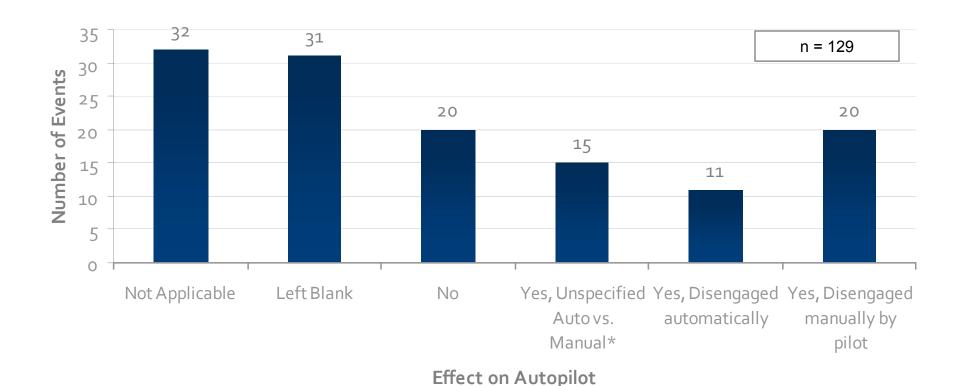




*Prior to April 2009 question update that distinguished between pilot disengaging or aircraft automatically disengaging. In April 2009, Question C.8 was revised to clarify automatic vs manual disengagement. It reads: C.8 If autopilot was engaged, did the wake encounter cause it to disengage? O Yes, disengaged automatically; O Yes, disengaged manually by pilot; O No; O Not Applicable



Consequences of WVE

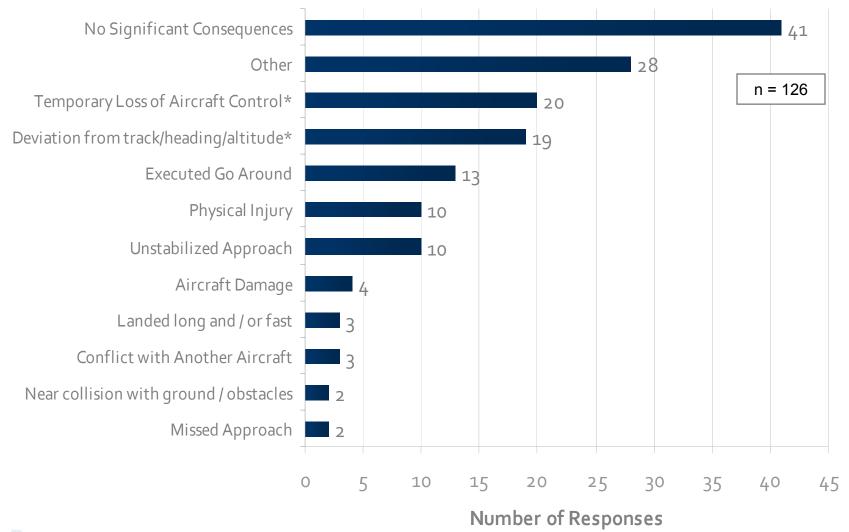



•Consequence categories are displayed in the order they are presented in the Supplemental Question Set (SQS)

•n=126. Consequence categories are not mutually exclusive. A single event may be coded as having more than 1 consequence

•*"Temporary" was added in April 2009 based on pilot feedback



Notable Reporter Comments

(An A320 7 miles behind a B747-400 at 2500 feet MSL on arrival to LAX)

Report Narrative: ... We were following a B747 on a visual approach by 4.5 miles. We encountered wake turbulence at about the time we usually put the gear down. We encountered it again at 1000 feet one dot above the glide slope and I remembered being annoyed that the B747 was high on glide slope. We missed the 1000 foot call. At 700 feet the gear warning bell sounded and we put the gear down before 500 feet... Fortunately, the system worked and we landed safely. —ACN 899943





Notable Reporter Comments

(A 737-800 10+ miles behind a B767-300 at 2500 feet on arrival to LAX)

Report Narrative: ... We were initially cleared for the ILS 25L approach ... to follow a B767 7 miles in front of us. ATC provided us the requisite caution wake turbulence following the heavy alert information. .. Shortly after the automated '2500 FT' audio call we experienced our first wake turbulence related roll. The pilot flying was already flying ½ dot to one dot high on the glideslope to risk mitigate the wake turbulence. Winds were calm at altitude and remained below 5 KTS and aligned with the runway throughout the approach and landing...

Shortly after passing LIMMA we experienced <u>our second</u>, <u>much more pronounced</u> and persistent roll associated with the heavy's wake turbulence....I failed to respond to [my] normal habit pattern because of my focus on the B767 in front of us and our flight path in relation to the heavy's. Consequently <u>we landed without acknowledging ATC's 'cleared to land' call</u> and I didn't realize it until we rolled out onto the high speed taxiway...That series of decisions drew my focus to the remainder of the approach and I believe was the <u>critical event which distracted me</u> to the point my clearance to land mnemonic wasn't accomplished and consequently the ATC clearance not acknowledged. ACN-897473

